


Combine #28

Serial Number 1H0S78SKJ0801076

Date	Part	Location	Price
11-May	Multiple Parts	Benson MN	\$4,961.11
11-May	Labor OCF	Hendricks MN	\$3,224.72
19-Sep	Rotor Sheave	OCF	\$3,151.36
19-Sep	Labor OCF	Hendricks MN	\$1,260.54

\$11,337.19

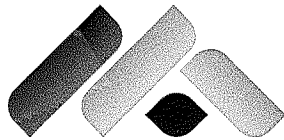

MIDWEST
MACHINERY CO

Serial Number#

1H0S780SKJ0801076

Date of Exp

7-16-21

OR

Hours

2000



PowerGard



PowerPro



Basic Warranty

#28

mmcjd.com

Midwest Machinery Co.
 380 Atlantic Avenue
 Benson, MN 56215
 Phone: (320) 843-2610



Invoice To Account No: 830138

SERVICE INVOICE

OLSEN CUSTOM FARMS LLC
 1355 300TH ST
 HENDRICKS MN 56136

 Phone Number: 507-275-3176

Invoice Number: 2139674
 Invoice Date: 05/11/2020
 Location: 16
 Work Order Number: 363748
 Payment Type: Account

 Page: 1 of 2

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
2018 JOHN DEERE S780	1011	1H0S780SKJ0801076	1H0S780SKJ0801076	

#28

Gen- Retail

COMPLAINT:

01 JG ORDER PARTS FOR CUSTOMER

CAUSE:

CORRECTION:

PartNumber	Description	Quantity	List Price	Extended Price	Taxed Ind
19M7823	Screw	1.00	8.83	\$7.68	N
A14629	SEAL	1.00	9.57	\$8.33	N
AH154697	ISOLATOR	1.00	6.67	\$5.80	N
AH163056	BEARING HO shoe auger	4.00	51.44	\$179.00	N
AH169549	IDLER outer rotary screen	1.00	42.33	\$36.83	N
AH226058	PULLEY 1/2 pulley	4.00	122.86	\$427.56	N
AXE19940	Idler Spro Feeder house Drive	1.00	34.06	\$29.63	N
AXE24984	Idler vac Idler	1.00	135.43	\$117.82	N
AXE27247	Roller Cha Feeder house chain	1.00	2,273.43	\$1,977.88	N
AXE39453	Bearing shoe auger	4.00	30.90	\$107.52	N
AXE54619	Roller Cha refresh	1.00	143.43	\$124.78	N
H137329	LOCK NUT	3.00	1.79	\$4.68	Y
H171960	STRIP	4.00	21.40	\$74.48	N
H215004	BLADE	10.00	8.46	\$73.60	N
HXE119772	Bolt	2.00	8.50	\$14.80	N
HXE123463	Chain Spro Feeder house	4.00	117.85	\$410.12	N
HXE138427	WEAR PLATE	1.00	19.39	\$16.87	N
HXE38073	V-Belt open Roller vac Belt	1.00	19.84	\$17.26	N
HXE54503	V-Belt Feeds accel	1.00	194.52	\$169.23	N
HXE84650	Driver loading auger	1.00	91.83	\$79.89	N
JD10018	BALL BEAR Feeder house upper	2.00	33.18	\$57.74	N
JD8554	ECCENTRIC	8.00	6.03	\$42.00	N
KXE10255	Knife Kit Chopper	6.00	181.25	\$946.14	N
L215374	BOLT	3.00	2.36	\$6.15	N

Miscellaneous Charges:

Shop Supplies \$0.00
 Environmental Fee \$25.00

Labor: \$0.00 Parts: \$4,935.79 OL&M: \$0.00 Misc: \$25.00 Sub-Total: \$4,960.79

CONTINUED ON NEXT PAGE->

Midwest Machinery Co.
 380 Atlantic Avenue
 Benson, MN 56215
 Phone: (320) 843-2610



Invoice To Account No: 830138

SERVICE INVOICE

OLSEN CUSTOM FARMS LLC
 1355 300TH ST
 HENDRICKS MN 56136

Phone Number: 507-275-3176

Invoice Number: 2139674
Invoice Date: 05/11/2020
Location: 16
Work Order Number: 363748
Payment Type: Account
Page: 2 of 2

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
2018 JOHN DEERE S780	1011	1H0S780SKJ0801076	1H0S780SKJ0801076	

Customer PO No:
Tax Exempt No: 19ST3-LOCM
Advisor: S1607

Labor: \$0.00
Parts: \$4,935.79
OL&M: \$0.00
Misc: \$25.00
Sales Tax: \$0.32
Total: \$4,961.11

work done at OCF
 Labor 3224.72
 8185.83

TERMS AND CONDITIONS

Received by:

Date:

2019-2020 COMBINE WINTER CHECKLIST

Serial # 801076

Eng Hrs 1010.8

Comb # 28

Sep Hrs 677.1

Date 4/16/2020

Person Working on Combine _____

Parts from
★ midwest

OK	FLIP	REPLACE	CHECKLIST	COMMENTS
		AS	~Change engine oil	
		AS	~Change engine oil filter	
		FG	~Replace engine air filter	LR - AS
		FG	~Replace cab filter/Engine Debris Filler	- O Feed Accel Vac
	O		~Clean out sediment bowl/Check Antifreeze	
		RC	~Change hydraulic filters/Hydro	
		AS	~Change fuel filters	
			~Loosen all belts/cracking, ider pulleys, spring tensioners	
	X		~Check lights	
			~Replace roller chains, soak in Oil	
		CP	~Change FH bearings 4 on Lower Drive / JO	10018 Brgs
		AS	~FH wear strips	
		AS	~FH top sprockets	
	X		~FH drum bearings	
		CP	~FH chain paddles	
		CP	~repalce FH bolts + Locktite	
			~Set proper belt tension on lower FH belt	
	X		1/8" gap between lower sheeves/Set top pulleys back	
	X		Check fridge seal	
	X		Set FH to 12 1/2" on turn buckles	
	X		~Multi coupler (oil leaks)	
	X		Check Front Rotor Brgs & Clean Rotor Speed Cable	Clean out
		CP	~FH backshaft speed sensor, reset set screw	Bearing
	X		~Hydro cable operation/Set speed?Lube Ball Joint	
	X		~2 full fire extinguisers Front & Full	
	X		Set for wheat harvest/Complete standard set up for winter wheat	
	X		3-4 bars of fuel/convex mirrors	
	X		owners manual/settings guide	
	X		Check & Clear Codes	
	X		~Armrest switch operation	
	X		Set Up G53	
	X		Check FH seal & lowers seal	
	X		~Check feed acclerator brgs	
		AS	~Check feed acclerator paddles	
	X		~Magnetic clutch operation/Front end Drive/Tighten Nut	
		AS	~Shoe auger backlash (LH/RH Bearings)/ Drive Shaft Brgs	Front & Rear Repair Backlash
	X		~Cotter pins on spring tighteners/Check Alignment on Front End Drive	Clean out a few of #1
		AS	~Shaker brgs & thru shaft brgs	Grease
		AS	~Check shaker arms/Clean out	
		RC	~Change concaves level & calibrate with inserts	
		AS	~Inspect threshing elements rotate if necessary, clean out	Double Check
	X		~Inspect seperator tines, make sure grate is up	
			Spacers on top	

CP - ~~O~~ Front small idler for FH Chain

	OK	FLIP	REPLACE	CHECKLIST	COMMENTS
41	X			~Unloading auger Jackshaft brgs/Silicone Acess doors/shear bolts	
42			O	~Check throw out brg & inspect cleaning fan (watch LH brg)	Throw/out Brg
43			- O AS	~Vertical auger drive & auger condition/check for play on bottom sprocket	Seal
44	X			~Check timing on unloading auger/Dribble Door	
45	XX			Adjust unload auger eyebolt	
46	X			~Clean out behind discharge beater pulley	
47			- O AS	~Check chopper jackshaft brgs/check detent on 2 speed	One Shim
48			- O RC	~Inspect rear side panels for cracking (by chopper)	Pivot Bushing on LH side
49			O AS	Grease chopper bearings	
49A			- O RC	~Chopper hammers	
49B			O - RC	~Chopper knife bank	will order 10 (mix + match)
49C	X			Check Alignment on discharge beater	
50			O AS	~Top sieve, try to set	Clean +
51			O AS	~Bottom sieve, try to set	Calibrate
52	X			Check Axle Bolts	
53	X			Hydro Hose Clamps/LH Shield Bracket	
54	X			~Shaker pan	
55	X			~Discharge beater brgs/Belts/check triple top belt	
56	X			~Discharge beater paddles & grate	
57	X			check wiring to grain loss monitor	
58	X			Destroke wire	
59	X			~Check rear axle for height & spacing Big wheels (axles down) Small wheels (axles up)	
60			PG O	~Check front & rear wheel bolts & rims	Inner Bolts on RH side
61			O AS	20 wheel bolts in hub/check threads	Lube all wheel bolts
62	X			Engine Ladder Bolt	
63				~install ladder kit/inspect rear handrail	Straighten / Bolts
64				Check turbo & oil cooler for leaks/oil leak by engine rail	
65			SS - O	~Check rotary screen drive & Belt	Too Outer Key
66A			O	~Alternator & fan belts & drives/Vaccum Fan Bearing	Belts Idler
67			O AS	~Clean grain sprockets	
68				~Clean grain bearings, take 1/2 link out	Tighten
69				~Tailings sprockets/Tailings Slip Clutch	
70			JS - O	Load Auger Driver & Dogs	
71				~Tailings elev bearings/Remove Chain	
72	X			Slide Front RH Pulley out	
73	X			Adjust moisture meter	
74	X			~Grease, Reel pump/rotor/fan	
75	X			~Install hitch, mic holder, radio bracket, antenna cap	
76	X			Final Drive Case leak	
77			O RC	~Check all gearbox oil level/Grain Tank/Rotor	
78			RC - O	~Change reverser oil (if over 500 hrs)	
79	X			~Change 90 gearcase oil (if over 500 hrs)	
80			O RC	~Check trans oil & final drive oil level	
81	X			~Check clean grain elevator boot for cracks	
82	X			~Blow out radiator	
83			O O	water traps off & in tool box/ladder, catwalk, chains	Ladder Shear Bolt
84	O			clean out cab & toolbox/put rental sticker on window	
85	O			Perform exhaust test/update software	
86	O			Wash before Shipping South/run machine	
87	X			Add grease fitting to rotor pulleys	
88	X			check tie rods	
89			AS O	Afterblower Idlers	
90	O AS			780s Clean out Behind batteries	

HX1241385

#28



Kibble Equipment LLC
1100 Highway 59 N
Marshall, MN 56258
Phone: 507-537-1524
www.kibbleeq.com



JOHN DEERE

Invoice To Account No.: 8303962

Deliver To Account No.: 8303962

PARTS INVOICE

OLSEN CUSTOM FARMS LLC
1355 300TH ST
HENDRICKS MN 56136
US

Bus Ph: 507-275-3176
Prv Ph: 507-275-3176 Mob Ph:

OLSEN CUSTOM FARMS LLC
1355 300TH ST
HENDRICKS MN 56136
US

Bus Ph: 507-275-3176
Prv Ph: 507-275-3176 Mob Ph:

Invoice No: 2541423
Date: 9/19/2020
Page: 1 of 1
Payment Type: Finance

Supplied Quantity	Back Order Quantity	Part Number	Part Description	Bin Loc	List Price	Net Price	Extended Price	Tax Ind
1.00	0.00	P48703	SNAP RING		10.08	9.07	\$9.07	N
2.00	0.00	R1225R	O-RING	A8D4	3.58	3.22	\$6.44	N
1.00	0.00	R26543	O-RING	B3F3	8.16	7.34	\$7.34	N
8.00	0.00	19M7789	SCREW	A9H4	1.46	1.31	\$10.48	N
1.00	0.00	H151592	BEARING HO		630.12	567.11	\$567.11	N
1.00	0.00	H173373	HUB		855.69	770.12	\$770.12	N
1.00	0.00	H173375	SHAFT		955.85	860.27	\$860.27	N
1.00	0.00	AH136497	SEAL	C10D1	20.40	18.36	\$18.36	N
1.00	0.00	AH144147	SEAL	B2I1	14.73	13.26	\$13.26	N
1.00	0.00	AH209207	BALL BEARI		163.47	147.12	\$147.12	N
1.00	0.00	AHC11302	HYDRAULIC	D3A2	657.54	591.79	\$591.79	N
1.00	0.00	FREIGHT	FREIGHT		150.00	150.00	\$150.00	N

INVOICE CONTAINS \$333.52 DISCOUNT

Customer Information		Finance Information		Parts Summary	
Customer PO No:	#28/LUKE	Type:	Multi-use Acct US	Auth. No:	835454
Salesperson:	JON FEUERHELM	Merchant No:	44000418	Card No:	xxxxxxxxxxxx3702
		Bill Code:	706 - JD SEEDING PARTS/SERVICE	Credit Plan:	11456 - 120 DAYS NO PAYMENTS/NO INTEREST
				Parts:	\$3,001.36
				Misc:	\$150.00
				Sales Tax:	\$0.00
				Deposit:	\$0.00
				Total:	\$3,151.36
				labor	1260.54

*** DOCUMENT COPY ***

labor done at OCF

4411.90

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the Multi-Use Account transaction. The following special terms, as described in the Multi-Use Account credit agreement, apply to the attached invoice. Up to 120 Days No Payments / No Interest Financing followed by the ANNUAL PERCENTAGE RATE (APR) applicable to your Account

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Credit for any returned unused parts must be made within 30 days and accompanied by this invoice. All parts returned are subject to a minimum 15% restocking fee. Open kits or electrical parts are no returnable, please refer to our return policy for details. Thank you for your business.

Received by: Date: